

# Agilent 34401A Multimeter

## Uncompromising Performance for Benchtop and System Testing

### Product Overview



- Measure up to 1000 volts with 6½ digits resolution
- 0.0015% basic dcV accuracy (24 hour)
- 0.06% basic acV accuracy (1 year)
- 3 Hz to 300 kHz ac bandwidth
- 1000 readings/s direct to GPIB

#### Superior Performance

The Agilent Technologies 34401A multimeter gives you the performance you need for fast, accurate bench and system testing. The 34401A provides a combination of resolution, accuracy and speed that rivals DMMs costing many times more. 6½ digits of resolution, 0.0015% basic 24-hr dcV accuracy and 1,000 readings/s direct to GPIB assure you of results that are accurate, fast, and repeatable.

#### Use It on Your Benchtop

The 34401A was designed with your bench needs in mind. Functions commonly associated with bench operation, like continuity and diode test, are built in. A Null feature allows you to remove lead resistance and other fixed offsets in your measurements. Other capabilities like min/max/avg

readouts and direct dB and dBm measurements make checkout with the 34401A faster and easier.

The 34401A gives you the ability to store up to 512 readings in internal memory. For trouble-shooting, a reading hold feature lets you concentrate on placing your test leads without having to constantly glance at the display.

#### Use It for Systems Testing

For systems use, the 34401A gives you faster bus throughput than any other DMM in its class. The 34401A can send up to 1,000 readings/s directly across GPIB in user-friendly ASCII format.

You also get both GPIB and RS-232 interfaces as standard features. Voltmeter Complete and External Trigger signals are provided so you can synchronize to other instruments in your test system. In addition, a TTL output indicates Pass/Fail results when limit testing is used.

To ensure both forward and backward compatibility, the 34401A includes three command languages (SCPI, Agilent 3478A and Fluke 8840A /42A), so you don't have to rewrite your existing test software. An optional rack mount kit is available.

#### Easy to Use

Commonly accessed attributes, such as functions, ranges, and resolution are selected with a single button press.

Advanced features are available using menu functions that let you optimize the 34401A for your applications.

The included Agilent IntuiLink software allows you to put your captured data to work easily, using PC applications such as Microsoft Excel® or Word® to analyze, interpret, display, print, and document the data you get from the 34401A. You can specify the meter setup and take a single reading or log data to the Excel spreadsheet in specified time intervals. Programmers can use ActiveX components to control the DMM using SCPI commands. To find out more about IntuiLink, visit [www.agilent.com/find/intualink](http://www.agilent.com/find/intualink)

#### 1-Year Warranty

With your 34401A, you get full documentation, a high-quality test lead set, calibration certificate with test data, and a 1-year warranty, all for one low price.



**Agilent Technologies**

## Accuracy Specifications $\pm$ (% of reading + % of range)<sup>1</sup>

Function	Range <sup>3</sup>	Frequency, etc.	24 Hour <sup>2</sup> $23^\circ\text{C} \pm 1^\circ\text{C}$	90 Day $23^\circ\text{C} \pm 5^\circ\text{C}$	1 Year $23^\circ\text{C} \pm 5^\circ\text{C}$	Temperature Coefficient $0^\circ\text{C}$ to $-18^\circ\text{C}$ $28^\circ\text{C}$ to $-55^\circ\text{C}$
<b>DC voltage</b>	100.0000 mV		0.0030 + 0.0030	0.0040 + 0.0035	0.0050 + 0.0035	0.0005 + 0.0005
	1.000000 V		0.0020 + 0.0006	0.0030 + 0.0007	0.0040 + 0.0007	0.0005 + 0.0001
	<b>10.000000 V</b>		<b>0.0015 + 0.0004</b>	<b>0.0020 + 0.0005</b>	<b>0.0035 + 0.0005</b>	<b>0.0005 + 0.0001</b>
	100.0000 V		0.0020 + 0.0006	0.0035 + 0.0006	0.0045 + 0.0006	0.0005 + 0.0001
	1000.0000 V		0.0020 + 0.0006	0.0035 + 0.0010	0.0045 + 0.0010	0.0005 + 0.0001
<b>True rms AC voltage<sup>4</sup></b>	100.0000 mV	3 Hz – 5 Hz	1.00 + 0.03	1.00 + 0.04	1.00 + 0.04	0.100 + 0.004
		5 Hz – 10 Hz	0.35 + 0.03	0.35 + 0.04	0.35 + 0.04	0.035 + 0.004
		10 Hz – 20 kHz	0.04 + 0.03	0.05 + 0.04	0.06 + 0.04	0.005 + 0.004
		20 kHz – 50 kHz	0.10 + 0.05	0.11 + 0.05	0.12 + 0.04	0.011 + 0.005
		50 kHz – 100 kHz	0.55 + 0.08	0.60 + 0.08	0.60 + 0.08	0.060 + 0.008
		100 kHz – 300 kHz <sup>6</sup>	4.00 + 0.50	4.00 + 0.50	4.00 + 0.50	0.20 + 0.02
	1.000000 V	3 Hz – 5 Hz	1.00 + 0.02	1.00 + 0.03	1.00 + 0.03	0.100 + 0.003
	to 750.000 V	5 Hz – 10 Hz	0.35 + 0.02	0.35 + 0.03	0.35 + 0.03	0.035 + 0.003
		<b>10 Hz – 20 kHz</b>	<b>0.04 + 0.02</b>	<b>0.05 + 0.03</b>	<b>0.06 + 0.03</b>	<b>0.005 + 0.003</b>
		20 kHz – 50 kHz	0.10 + 0.04	0.11 + 0.05	0.12 + 0.04	0.011 + 0.005
<b>Resistance<sup>7</sup></b>	100.0000 $\Omega$	1 mA Current Source	0.0030 + 0.0030	0.008 + 0.004	0.010 + 0.004	0.0006 + 0.0005
	1.000000 k $\Omega$	1 mA	0.0020 + 0.0005	0.008 + 0.001	0.010 + 0.001	0.0006 + 0.0001
	<b>10.000000 k<math>\Omega</math></b>	100 $\mu\text{A}$	<b>0.0020 + 0.0005</b>	<b>0.008 + 0.001</b>	<b>0.010 + 0.001</b>	<b>0.0006 + 0.0001</b>
	100.0000 k $\Omega$	10 $\mu\text{A}$	0.0020 + 0.0005	0.008 + 0.001	0.010 + 0.001	0.0006 + 0.0001
	1.000000 M $\Omega$	5.0 $\mu\text{A}$	0.002 + 0.001	0.008 + 0.001	0.010 + 0.001	0.0010 + 0.0002
	10.000000 M $\Omega$	500 nA	0.015 + 0.001	0.020 + 0.001	0.040 + 0.001	0.0030 + 0.0004
	100.0000 M $\Omega$	500 nA    10 M $\Omega$	0.300 + 0.010	0.800 + 0.010	0.800 + 0.010	0.1500 + 0.0002
<b>DC current</b>	10.000000 mA	< 0.1 V Burden Voltage	0.005 + 0.010	0.030 + 0.020	0.050 + 0.020	0.0020 + 0.0020
	<b>100.0000 mA</b>	< 0.6 V	<b>0.010 + 0.004</b>	<b>0.030 + 0.005</b>	<b>0.050 + 0.005</b>	<b>0.0020 + 0.0005</b>
	1.000000 A	< 1.0 V	0.050 + 0.006	0.080 + 0.010	0.100 + 0.010	0.0050 + 0.0010
	3.000000 A	< 2.0 V	0.100 + 0.020	0.120 + 0.020	0.120 + 0.020	0.005 + 0.0020
<b>True rms AC current<sup>4</sup></b>	<b>1.000000 A</b>	3 Hz – 5 Hz	1.00 + 0.04	1.00 + 0.04	1.00 + 0.04	0.100 + 0.006
		5 Hz – 10 Hz	0.30 + 0.04	0.30 + 0.04	0.30 + 0.04	0.035 + 0.006
		<b>10 Hz – 5 kHz</b>	<b>0.10 + 0.04</b>	<b>0.10 + 0.04</b>	<b>0.10 + 0.04</b>	<b>0.015 + 0.006</b>
	3.000000 A	3 Hz – 5 Hz	1.10 + 0.06	1.10 + 0.06	1.10 + 0.06	0.100 + 0.006
		5 Hz – 10 Hz	0.35 + 0.06	0.35 + 0.06	0.35 + 0.06	0.035 + 0.006
		10 Hz – 5 kHz	0.15 + 0.06	0.15 + 0.06	0.15 + 0.06	0.015 + 0.006
<b>Frequency or period<sup>8</sup></b>	100 mV to 750 V	3 Hz – 5 Hz	0.10	0.10	0.10	0.005
		5 Hz – 10 Hz	0.05	0.05	0.05	0.005
		10 Hz – 40 Hz	0.03	0.03	0.03	0.001
		<b>40 Hz – 300 kHz</b>	<b>0.006</b>	<b>0.01</b>	<b>0.01</b>	<b>0.001</b>
<b>Continuity</b>	1000.0 $\Omega$	1 mA test current	0.002 + 0.030	0.008 + 0.030	0.010 + 0.030	0.001 + 0.002
<b>Diode test<sup>9</sup></b>	1.0000 V	1 mA test current	0.002 + 0.010	0.008 + 0.020	0.010 + 0.020	0.001 + 0.002

<sup>1</sup> Specifications are for 1 hr warm-up and 6½ digits, slow ac filter.

<sup>2</sup> Relative to calibration standards.

<sup>3</sup> 20% over range on all ranges except 1000 Vdc and 750 Vac ranges.

<sup>4</sup> For sinewave input > 5% of range. For inputs from 1% to 5% of range and < 50 kHz, add 0.1% of range additional error.


<sup>5</sup> 750 V range limited to 100 kHz or  $8 \times 10^7$  Volt-Hz.

<sup>6</sup> Typically 30% of reading error at 1 MHz.

<sup>7</sup> Specifications are for 4-wire ohms function or 2-wire ohms using Math Null. Without Math Null, add 0.2  $\Omega$  additional error in 2-wire ohms function.

<sup>8</sup> Input >100 mV. For 10 mV to 100 mV inputs multiply % of reading error x10.

<sup>9</sup> Accuracy specifications are for the voltage measured at the input terminals only. 1 mA test current is typical. Variation in the current source will create some variation in the voltage drop across a diode junction.

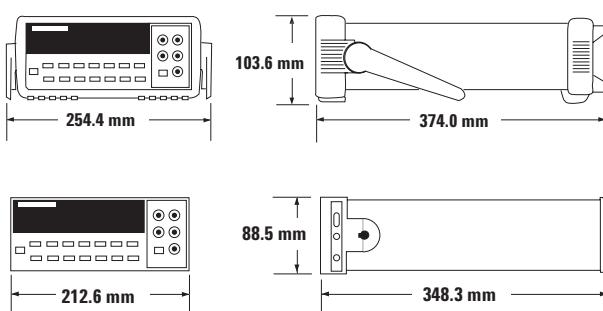

## Measurement Characteristics

### DC Voltage

#### Measurement Method:

Continuously integrating multi-slope III A-D converter

#### A-D Linearity:

0.0002% of reading + 0.0001% of range

#### Input Resistance:

10 MΩ or 0.1 V, 1 V, 10 V ranges:  
Selectable > 10,000 MΩ

100 V, 1000 V ranges: 10 MΩ ±1%

Input Bias Current: < 30 pA at 25°C

#### Input Protection:

1000 V all ranges

#### dcV:dcV ratio accuracy:

$V_{\text{input}}$  Accuracy +  $V_{\text{relevance}}$  Accuracy

### True RMS AC Voltage

#### Measurement Method:

AC-coupled true rms-measures the ac component of the input with up to 400 Vdc of bias on any range.

#### Crest Factor:

Maximum of 5:1 at full scale.

#### Additional Crest Factor errors (non-sinewave):

Crest factor 1-2: 0.05% of reading

Crest factor 2-3: 0.15% of reading

Crest factor 3-4: 0.30% of reading

Crest factor 4-5: 0.40% of reading

#### Input Impedance:

1 MΩ ± 2% in parallel with 100 pF

#### Input Protection:

750 Vrms all ranges

### Resistance

#### Measurement Method:

Selectable 4-wire or 2-wire Ohms.  
Current source referenced to LO input.

#### Maximum Lead Resistance (4-wire):

10% of range per lead for 100 Ω, 1 kΩ ranges.  
1 kΩ per lead on all other ranges.

#### Input Protection:

1000 V all ranges

### DC Current

#### Shunt Resistance:

5 Ω for 10 mA, 100 mA  
0.1 Ω for 1 A, 3 A

#### Input Protection:

Externally accessible 3 A 250 V fuse  
Internal 7 A 250 V fuse

### True RMS AC Current

#### Measurement Method:

Directly coupled to the fuse and shunt.  
ac coupled true rms measurement  
(measures the ac component only).

#### Shunt Resistance:

0.1 Ω for 1 A and 3 A ranges

#### Input Protection:

Externally accessible 3 A 250 V fuse  
Internal 7 A 250 V fuse

### Frequency and Period

#### Measurement Method:

Reciprocal counting technique

#### Voltage Ranges:

Same as ac voltage function

#### Gate Time:

1 s, 100 ms, or 10 ms

### Continuity/Diode

#### Response Time:

300 samples/s with audible tone

#### Continuity Threshold:

Selectable from 1 Ω to 1000 Ω

### Measurement Noise Rejection 60 (50) Hz<sup>1</sup>

#### dc CMRR:

### Triggering and Memory

#### Reading HOLD Sensitivity:

10%, 1%, 0.1%, or 0.01% of range

#### Samples/Trigger:

1 to 50,000

#### Trigger Delay:

0 to 3600 s: 10 μs step size

#### External Trigger Delay:

< 1 ms

#### External Trigger Jitter:

< 500 μs

#### Memory:

512 readings

### Math Functions

NULL, min/max/average, dBm, dB, limit test  
(with TTL output)

### Standard Programming Languages

SCPI (IEEE-488.2), Agilent 3478A,

Fluke 8840A/42A

### Accessories Included

Test lead kit with probe, alligator  
and grabber attachments

Operating manual, service manual,  
test report and power cord

### General Specifications

#### Power Supply:

100 V/120 V/220 V/240 V ±10%

#### Power Line Frequency:

45 Hz to 66 Hz and 360 Hz to 440 Hz,  
Automatically sensed at power-on

#### Power Consumption:

25 VA peak (10 W average)

#### Operating Environment:

Full accuracy for 0°C to 55°C,  
Full accuracy to 80% R.H. at 40°C

#### Storage Temperature:

-40°C to 70°C

#### Weight:

3.6 kg (8.0 lbs)

#### Safety:

Designed to CSA, UL-1244, IEC-348

#### RFI and ESD:

MIL-461C, FTZ 1046, FCC

#### Vibration & Shock:

MIL-T-28800E, Type III, Class 5 (sine only)

#### Warranty:

### Operating Characteristics<sup>4</sup>

Function	Digits	Reading/s
dcV, dcl, and Resistance	6 1/2	0.6 (0.5)
	6 1/2	6 (5)
	5 1/2	60 (50)
	5 1/2	300
	4 1/2	1000
acV, acl	6 1/2	0.15 slow (3 Hz)
	6 1/2	1 medium (20 Hz)
	6 1/2	10 fast (200 Hz)
	6 1/2	50 <sup>5</sup>
Frequency or Period	6 1/2	1
	5 1/2	9.8
	4 1/2	80

### Frequency and Period

Configuration rates:	26/s to 50/s
Autorange rate (dc Volts):	>30/s
ASCII readings to RS-232:	55/s
ASCII readings to RS-232:	1000/s
Maximum internal trig rate:	1000/s
Max. ext trig. rate to memory:	1000/s

<sup>1</sup> For 1 kΩ unbalanced in LO lead,  
± 500 V peak maximum.

<sup>2</sup> For power line frequency ± 0.1%.

<sup>3</sup> For power line frequency ± 0.1% use 40 dB  
or ± 3% use 30 dB.

<sup>4</sup> Reading speeds for 60 Hz and (50 Hz) operation.

<sup>5</sup> Maximum useful limit with default settling  
delays defeated.

<sup>6</sup> Speeds are for 4 1/2 digits, delay 0, auto-zero  
and display OFF.

## Ordering Information

### Agilent 34401A multimeter

#### accessories included:

Test lead kit with probe, alligator, and grabber attachments, operating manual, service manual, calibration certificate, test report, and power cord.

### Options

#### 34401A-1CM

Rack mount kit\*  
(P/N 5063-9240)

#### 34401A-0BO

DMM without manuals

#### 34401A-A6J

ANSI Z540 compliant calibration

### Manual Options

(Please specify one)

**34401A-ABA** US English

**34401A-ABD** German

**34401A-ABE** Spanish

**34401A-ABF** French

**34401A-ABJ** Japanese

**34401A-ABZ** Italian

**34401A-AB0** Taiwan Chinese

**34401A-AB1** Korean

**34401A-AB2** Chinese

**34401A-AKT** Russian

### Agilent Accessories

**11059A** Kelvin probe set

**11060A** Surface mount device (SMD) test probes

**11062A** Kelvin clip set

**34131** Hard transit case

**34161A** Accessory pouch

**34171B** Input terminal connector (sold in pairs)

**34172B** Input calibration short (sold in pairs)

**34330A** 30 A current shunt

**E2308A** 5 k thermistor probe

\* For racking two side-by-side, order both items below:

Lock link kit (P/N 5061-9694)

Flange kit (P/N 5063-9212)

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2007  
Printed in USA, December 20, 2007  
5968-0162EN

Authorized Agilent Distributor

Click here to Buy:



800.800.5001  
Transcat.com



Agilent Technologies